

Dehumidification, 0-10V Digital Wall Humidistat Installation Instructions

This document covers the operation and installation instructions for the following Condair digital humidistat:

Kit No.	Description
---------	-------------

2602797	0-10 V Digital Wall Humidistat
---------	--------------------------------

1 – Mounting and Installation

Location:

Mount the humidity controller Condair RDC-NA in a protected and easy accessible place at least 1.5 m above the floor to the wall (mounting on flush-mounting or surface-mounting box). Observe the following placement notes:

- Do not place Condair RDC-NA in niches, behind, curtains, etc.
- Do not place the Condair RDC-NA near heat sources, within the area with direct air draft or direct sunlight.

Installation:

Refer to installation overview in section 2.

1. Open the screw of the housing and remove mounting plate with the connecting unit.
2. Connect wires of the connection cable to the terminals according to the wiring diagram.
3. At the place of location fix mounting plate (plastic screw facing downwards) with two screws to the flush-mounting or wall-mounting box (see dimensional drawing).
4. Carefully snap housing onto the mounting plate and fix it with the screw (do not tighten screw too much).

Note: We recommend using 18-gauge wire, and maximum <100 ft distance from the unit.

2 – Installation overview



**RDC-NA
2602797**

A

mm (inch)

B

C

D

E

	0V / GND	24V	N/A	N/A	N/A	AO 0-10V	N/A	Temp. Reset
1	2	3	4	5	6	7	8	

6 (0.02)


1: 0V / GND
 2: 24 V AC/DC $\pm 10\%$
 3: Do not connect
 4: Do not connect
 5: Do not connect
 6: 0...10VDC
 7: Do not connect
 8: Temp. Reset

Download on the
App Store

For Wiring Schematic:
Get the Condair
Sensor Connect App

GET IT ON
Google Play

3 – Wall Humidistat LCD Display

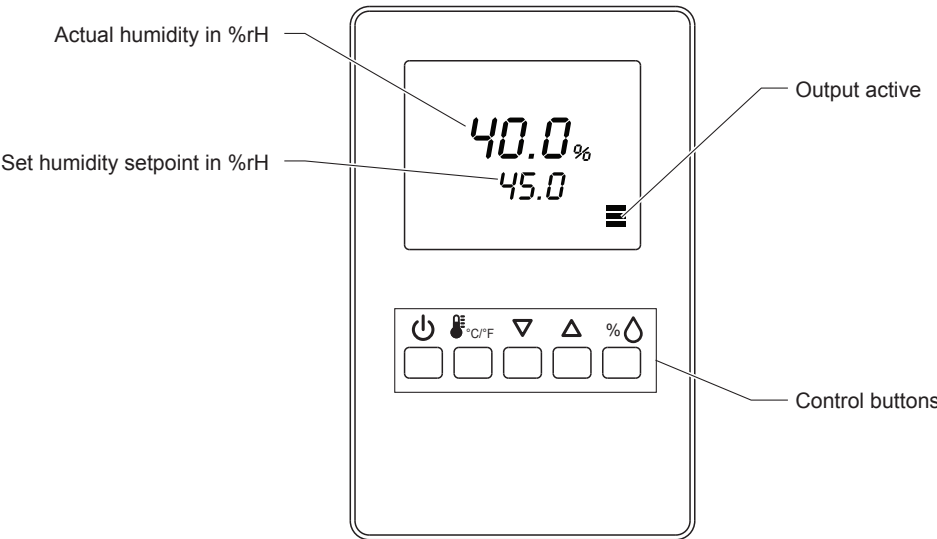

Buttons	Operation	Function
	press long	Switching On and Off
	press briefly	—
	press long	Switching between °C and °F
	press briefly	Adjusting set point value
	press briefly	Shows %rH value
	press long	Offset settings

Fig. 1: Wall Humidistat LCD Display and function of control buttons

4 – Configuration

Using keypad, set specified humidity. For general health and comfort, a humidity setting of 50% is recommended.

5 – Error Messages

- Err 1: Sensor element in the device is not properly inserted or defective. Insert the sensor element correctly or replace it.
- Err2, 3 & 4: Hardware or memory problem. Replace device.

6 – Sensor Calibration

Sensor inputs can be calibrated if needed

Press % > 2 sec. UI and its value is displayed.	75%
Press %: Calibration value and tool symbol is displayed, UP/DOWN to calibrate,	UI 1
Press %: Save calibration, tool symbol disappears.	
Press UP key again to step through the next active input	0.0%
Note: disable inputs will not be shown	..UI 1

7 – Setting Parameters to Configure the Controller

The control operation is defined by parameters set using the standard operation terminal. There are two levels:

- User/display parameters (password 0009)
- Control parameters (password 00241)

How to change the parameters:

1. Press <Δ>/<▽> button simultaneously for three seconds. The display will show firmware version and revision number.
2. Press the <◀◊> button to start login. The small digits show "CODE".
3. Select correct code (password) using <Δ> and <▽> buttons.
Note: Code to access user parameters is "0009". The access codes are fixed and cannot be changed.
4. Press the <◀◊> button after selecting the correct code.
5. Once logged in with "0009", the user/display parameters are displayed immediately.
6. Select the parameters with the <Δ> or <▽> button. Change a parameter by pressing the <◀◊> button. The symbol ✕ is displayed to indicate that the parameter may be modified. Use <Δ> or <▽> button to adjust the value.
7. After you are done, press <◀◊> button to save the new value and return to the selection level (symbol ✕ disappears after selection is saved). Pressing <⏏> button without pressing <◀◊> button will discard the value and return without saving.
8. Press the <⏏> button to leave the menu. The unit will return to normal operation if no button is pressed for more than 5 minutes.

User Parameters (Password 0009)

Table 1: User Parameters

Parameter	Description	Range	Default
UP 00	Enable change of operation modes	ON, OFF	ON (Enabled)
UP 01	Enable change of setpoints	ON, OFF	ON (Enabled)
UP 02	State after power failure: 0 = Switched OFF, 1 = Switched ON, 2 = state before power failure	0, 1, 2	2
UP 03	Celsius or Fahrenheit: ON = Fahrenheit, OFF = Celsius	ON, OFF	OFF (Celsius)
UP 04	Select type of content for large digits (00= OFF): 01 = Input 02 = Setpoint 03 = Humidity Sensor 04 = External Temperature Sensor	00...04	01

Control Parameters (Password 0241)

Note: Only experts should change these settings! See user parameter for login procedure!

Table 2: Output Configuration

Parameter	Description	Range	Default
CP 00	Minimum setpoint limit in humidification mode	0..100%	10%
CP 01	Maximum setpoint limit in humidification mode	0..100%	90%
CP 02	Start delay for fans (Time the fan runs before control output starts)	0...255 s	10 s
CP 03	Stop delay for fan (Time the fan keeps running after control output stops)	0...255 s	90 s

Table 3: Temperature Setback Configuration – *For humidity control only

Parameter	Description	Range	Default
CP 04	Enable temperature setback OFF = Temperature set back is disabled ON =Temperature setback is enabled	ON, OFF	OFF
CP 05	Setpoint limit at full setback	0..100 %	20 %
CP 06	Lower temperature limit: Outside temperature with maximum setback The setback will be equal to the minimum setpoint limit	-40...60°C -40...160°F	-30 °C (-22°F)
CP 07	Upper temperature limit: Outside temperature at begin of setback	-40...60°C 40...160°F	0 °C (32°F)
CP 08	Number of seconds taken into account to calculate the average input signal Low value = fast response High value = slow response	0...100	30

8 – Product Specification

Power Supply	Operating Voltage Power Consumption Terminal Connections	24 V AC 50/60 Hz $\pm$ 10 %, 24 VDC $\pm$ 10 % Max. 3 VA For wires 0.34...2.5 mm ² (AWG 24...12)
Sensor Probe (Humidity Sensor)	Measuring element Range Accuracy Hysteresis Repeatability Stability	Capacitive measuring element 0...100 % RH $\pm$ 3.0 % at 25 °C $\pm$ 1% $\pm$ 0.1% < 0.5% / Year
Signal Outputs	Analog Outputs Analog Signal Resolution Maximum Load	AO1 0...10 VDC or 0...20mA 39 mV or 0.0078 mA 10 mA (at 0...10 VDC) 20 mA (at 0...20mA)
Environment	Operation Temperature Humidity	IEC 721-3-3 0...50°C 32...122°F) <95 %rH not condensing
General	Housing Materials Mounting Plate Weight (including packaging)	ABS Galvanized Steel 260 g (9.2oz)

9 – Wiring Diagrams

Wiring diagram RDC-NA for DA

